

Date: Monday, 12/05/2008 1:57:14 PM
 User: Julie Lecocq

Process Sheet

Customer :	CC-DAR01 Dart Aerospace Ltd.	Drawing Name :	COBRA SKIDTUBE ASS'Y
Job Number :	39206		
Estimate Number :	13181		
P.O. Number :		Part Number :	D209669043
This Issue :	12/05/2008	S.O. No. :	
Prsht Rev. :	NC	Drawing Number :	D2906 REV.B
First Issue :	//	Project Number :	N/A
Previous Run :	39205	Drawing Revision :	B
	Type :	Material :	
	SKIDTUBES	Due Date :	23/05/2008
Written By :		Qty:	1 Um: Each
Checked & Approved By :	JLD 08.5.12		
Comment :	new est. 08.02.13 LL, verified by: DD		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy D209-669 bluefile & type labels per PPP D205-669-041.chg 002

JLD
08.5.13

2.0	D25001190	Ext'n -1' Beam Tube 4"
-----	-----------	------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2500-1-190	Skid Tube Extrusion	37544

4T 08-05-13

3.0	D29263	Web
-----	--------	-----



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

X Web
 batch 39225 SL 8-5-13

4.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------



Comment: LANDING GEAR RESOURCE 1

1- Inspect mat'l D2500-1-190 for damage

2-Cut D2500-1-190 per Dwg D2906 if necessary Deburr ends

3-Acid etch and Alodine tube per QSI 005 4.1

4T 08-05-13

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 12/05/2008 1:57:14 PM
User: Julie Lecocq

Process Sheet

Customer: CC-DAR01 Dart Aerospace Ltd.

Drawing Name: COBRA SKIDTUBE ASS'Y

Job Number: 39206

Part Number: D209669043

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

D H 8-5-13

6.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes using drill jig DT8149, DT8711-2 & DT8711-3 (Do not use cutting fluid)

2-Open holes to 0.500" as per Dwg D2906 without cutting fluid

3-Countersink holes as per Dwg D2906 without cutting fluid

4-Deburr and blow out all chips from inside of tube

5-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty	Part Number	Description	Batch
A/R	Sikaflex-291	107804	

Sikaflex expire date: 8-7-31

Start Time: 4:00 Date: 8-5-13

Fin Time: 4:00 Date: 08 05 14

pick:

Qty	P/N	description	B/N
1	D2926-3	Web	39225

7.0

BENDING

BENDING MACHINE - SKIDTUBES



Comment: BENDING MACHINE

1-Bend as per program COB41FWD & COBRAFT on CNC Bender and Folio FT

2-Cut tubes as per Dwg. D2906 & per template DT8185B & DT8185BC

EL/IT

8-5-14

8.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends

2-Prepare tube for welding, remove alodine as required.

7 SL 8-5-14

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 12/05/2008 1:57:14 PM
User: Julie Lecocq

Process Sheet

Customer: CC-DAR01 Dart Aerospace Ltd.

Drawing Name: COBRA SKIDTUBE ASSY

Job Number: 39206

Part Number: D209669043

Job Number:



Seq. #:

Machine Or Operation:

Description :

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08/05/20 (40)

10.0

D2579

Crossbolt Spacer



Comment: Qty.: 19.0000 Each(s)/Unit Total: 19.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
19	D2579	Spacers	238393

BE 08/05/20

11.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

1-Weld crossbolt spacers D2579 as per Dwg. D2906 and QSI 004.

For D2579 spacers, weld one side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R Aluminum Rod

m107877

BE 08/05/20

2-Grind welds as per Dwg D2906 Grind flush ridge made from bending

3-Drill holes for wearplates using DT8217 Open holes to 19/64", adjust stopper not to hit web. Debur

4-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2906, Debur holes

5-Drill pilot holes for aft & fwd cap using DT8025 open holes to #6" Debur

6-Drill pilot holes for Tow ring using DT8091-3, open to .640" and Debur

285-20

12.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

08/05/20 (40)

13.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08/05/20 (40)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 12/05/2008 1:57:14 PM
User: Julie Lecocq

Process Sheet

Customer: CC-DAR01 Dart Aerospace Ltd.

Drawing Name: COBRA SKIDTUBE ASS'Y

Job Number: 39206

Part Number: D209669043

Job Number:



Seq. #:

Machine Or Operation:

Description :

14.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1
Pressure wash as per QSI 005

bf 08-05-20 (1)

15.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING
Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

M 107923

(1X)

START TIME:

10:20 am

OVEN TEMPERATURE:

320 °F

FINISH TIME:

10:50 am

M-1 08/05/21

16.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

08-05-26

(21)

17.0

D2855

Cap



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Cap

Batch: *1338395*

YJ

18.0

AN35A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Bolt

Batch: *M100188*

YJ

19.0

AN960JD10L

Washer



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Washer

Batch: *M1001885*

YJ

20.0

ALS71032130

Insert



Comment: Qty.: 44.0000 Each(s)/Unit Total: 44.0000 Each(s)

Insert

OR PER QSI 017

Batch: *M105855*

YJ

08-05-26

(21)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 12/05/2008 1:57:15 PM
User: Julie Lecocq

Process Sheet

Customer: CC-DAR01 Dart Aerospace Ltd.

Drawing Name: COBRA SKIDTUBE ASSY

Job Number: 39206

Part Number: D209669043

Job Number:



Seq. #:

Machine Or Operation:

Description :

21.0

AN3C4A

BOLT



Comment: Qty.: 44.0000 Each(s)/Unit Total: 44.0000 Each(s)

BOLT

Batch: M108077

JS

22.0

AN960C10L

washer



Comment: Qty.: 44.0000 Each(s)/Unit Total: 44.0000 Each(s)

washer

Batch: M108077

JS

23.0

D25943

O-Ring, 205 Skidtube



Comment: Qty.: 14.0000 Each(s)/Unit Total: 14.0000 Each(s)

O-Ring

Batch: B29908

JS

24.0

D25941

Plug, 205 Skidtube



Comment: Qty.: 14.0000 Each(s)/Unit Total: 14.0000 Each(s)

Plug

Batch: B37419

JS

25.0

D35649

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WEARSHOE

batch: B38408

JS

26.0

D356411

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WEARSHOE

batch: B38548

JS

27.0

D35645

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WEARSHOE

batch: B38409

JS

08-05-26

(X)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 12/05/2008 1:57:15 PM
User: Julie Lecocq

Process Sheet

Customer: CC-DAR01 Dart Aerospace Ltd.

Drawing Name: COBRA SKIDTUBE ASSY

Job Number: 39206

Part Number: D209669043

Job Number:



Seq. #:

Machine Or Operation:

Description :

28.0

D35661

Gasket



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

GASKET

batch 1339236

911

29.0

D35665

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

GASKET

batch 1338647

911

30.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates as per Dwg. D2906. Use a drop of Sikaflex on insert holes before installing wearplates

A/R Sikaflex-291 14107804

Sikaflex expire date: 08/10

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2906

3-Inspect for foreign object per QSI 024

4-Install D2855 Fwd & Aft Cap as per Dwg D2906 and seal Fwd & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291 14107804

Sikaflex expire date: 08/10

5-Wing Walk as per Dwg D2906 and QSI 005 4.4

Batch: 14107892

910

08-05-26

(X)

31.0

QC5

INSPECT WORK TO CURRENT STEP



08/05/26 (X)



Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

32.0

PACKAGING 1

PACKAGING RESOURCE #1



(X)

Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D209-669-041

Location:

PPP Rev:

A

8/5/27

SP

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 12/05/2008 1:57:15 PM
User: Julie Lecocq

Process Sheet

Customer: CC-DAR01 Dart Aerospace Ltd.

Drawing Name: COBRA SKIDTUBE ASS'Y

Job Number: 39206

Part Number: D209669043

Job Number:



Seq. #:

Machine Or Operation:

Description :

33.0

QC21

FINAL INSPECTION/W/O RELEASE




08/05/28 *[Signature]*

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



MF 08-05-27

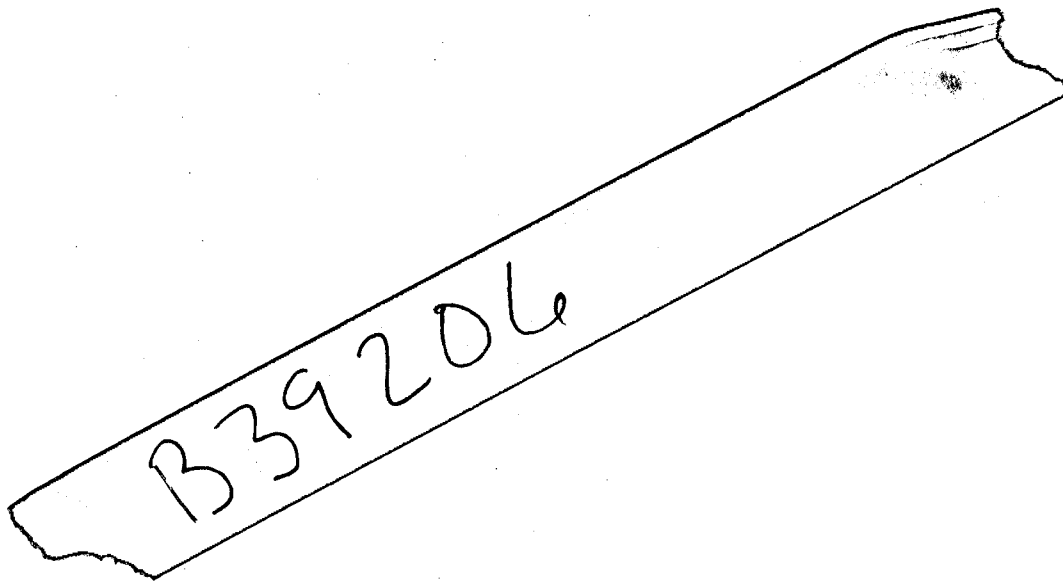


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

 NOTE: Date & initial all entries



QTY -041	QTY -043	Part Number	Description
X		D2906-041	SKIDTUBE ASSEMBLY
	X	D2906-043	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
22	19	D2579	CROSS BOLT SPACER
12	14	D2594-1	PLUG
12	14	D2594-3	O-RING
2	2	D2855	AFT CAP
1		D2926-1	WEB
	1	D2926-3	WEB
1	1	D3564-9	WEARSHOE (REPLACES D2577-1)
1	1	D3564-11	WEARSHOE (REPLACES D2577-3)
1	1	D3564-5	WEARSHOE (REPLACES D2577-5)
1		D3564-15	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1		D3566-15	GASKET
50	44	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or ALS4-1032-130	INSERT
50	44	AN3C4A	BOLT
4	4	AN3-5A	BOLT
50	44	AN960C10L	WASHER
4	4	AN960JD10L	WASHER

GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 2) LENGTH OF D2500-1 EXTRUSION BEFORE BENDING = 190 INCHES.
- 3) INSERT D2926-1/-3 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/291 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 6) USE DART DRILL TEMPLATE DT2906-041T1 (D2906-041) OR DT2906-043T1 (D2906-043) TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION C-C AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/291.
- 7) WELDING TO BE DONE PER DART QSI 004.
- 8) FINISH:
ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2926-1/-3 WEB. POWDER COAT ASSEMBLY WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4
- 9) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (12 PLACES).
- 10) ALL DIMENSIONS ARE IN INCHES.

SHOP COPY
RETURN TO
ENGINEERING


UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 39206

RELEASED


07.09.04

B	UPDATE DRAWING FORMAT; RE-ORGANIZE; ADD STAINLESS STEEL WEARPLATES AND GASKETS CHANGE WEARPLATE HARDWARE TO SS; PG 1: ADD NOTE 10; PG 2 C7: REMOVE AFT Ø0.640 HOLE FROM -041; PG 3 C3: CORRECTED -043 CAP P/N; PG 3 D7: 38 PLACES WAS 44 PLACES;	CB	07.08.21
A	NEW ISSUE	CP	04.06.22
REV.	DESCRIPTION	BY	DATE
DESIGN	qp	DART AEROSPACE LTD	
DRAWN	CB	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PH	DRAWING NO.	REV. B
MFG. APPR.	PH	D2906	SHEET 1 OF 3
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	AH-1 (209) SKIDTUBE ASSEMBLY	NTS
DATE	07.08.21	COPYRIGHT © 2004 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


8 7 6 5 4 3 2 1

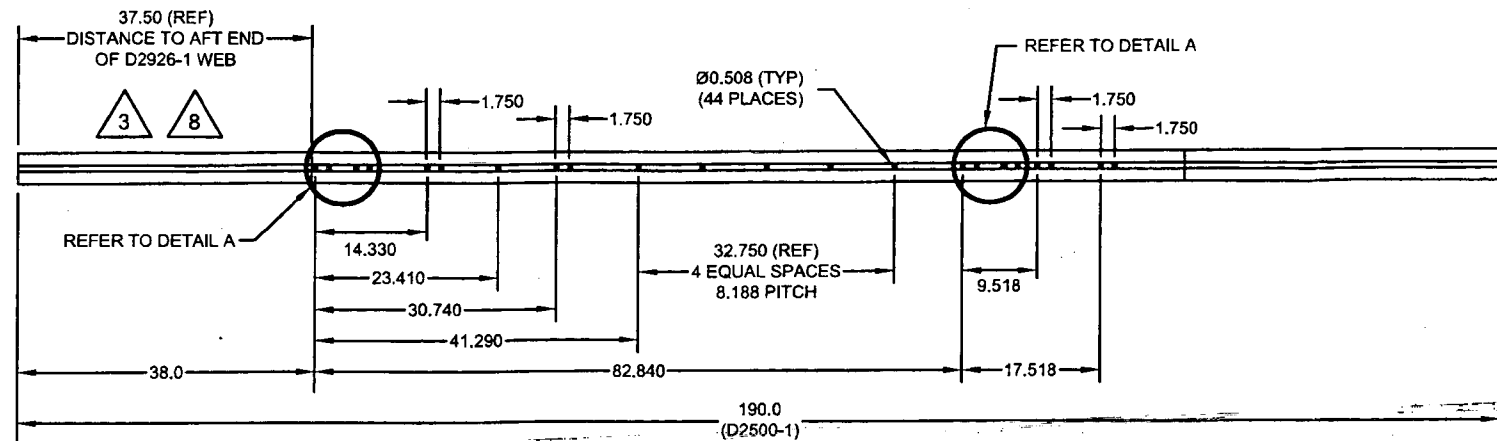


D2906-1 DRILLING DETAIL

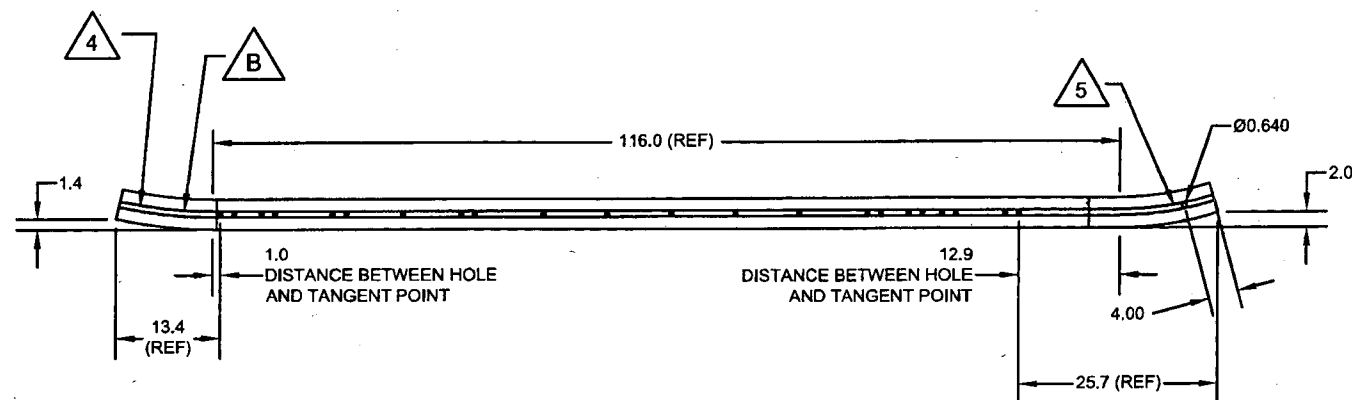


D2906-041 BENDING AND CUTTING DETAIL

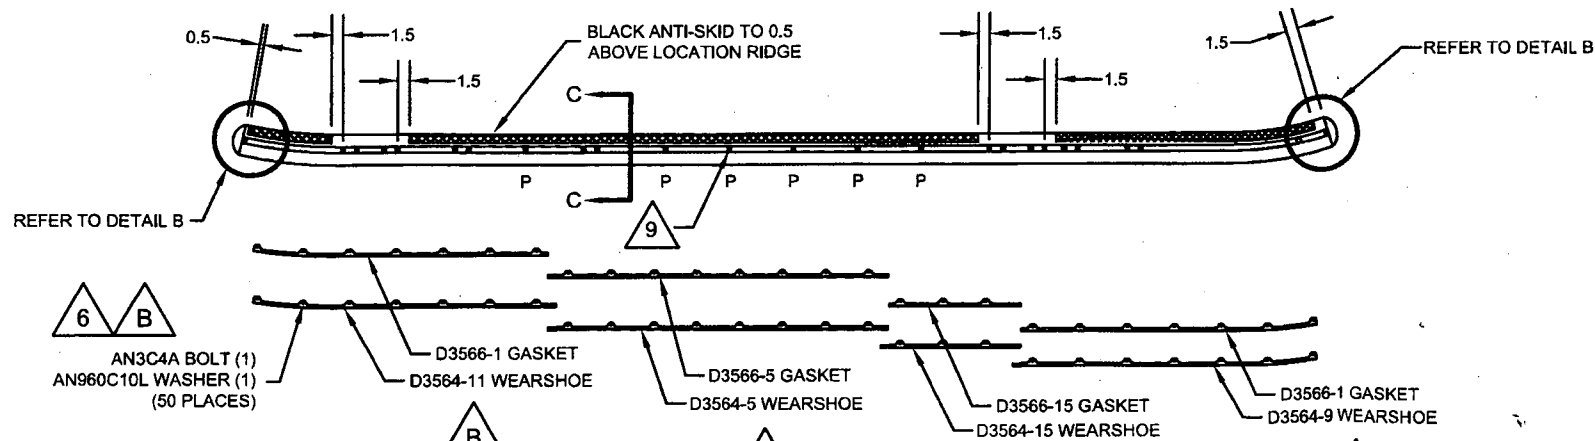

D2906-041 ASSEMBLY DETAIL

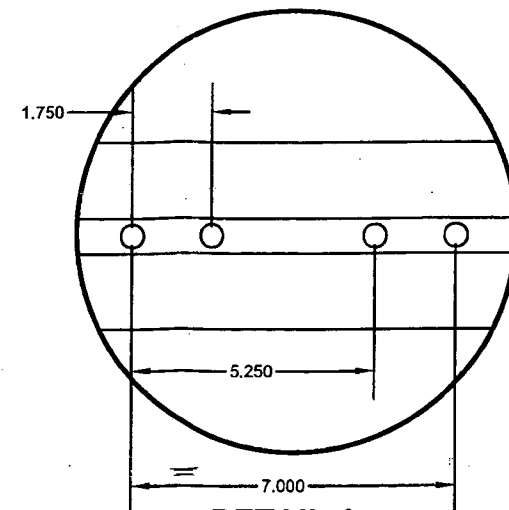


DETAIL A
SCALE 1:4

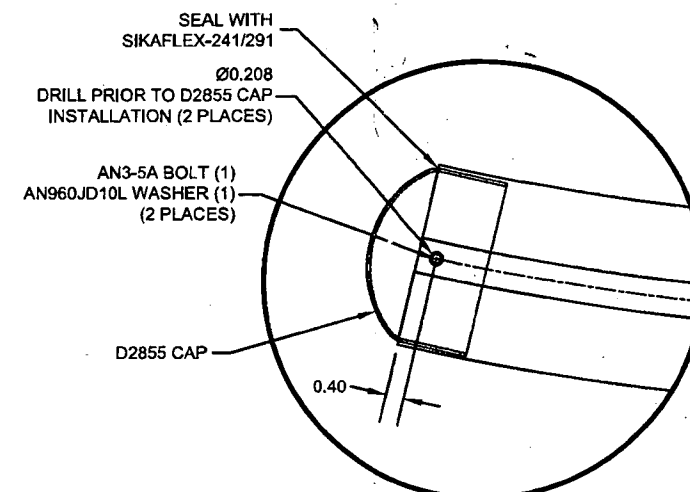

DETAIL B
SCALE 1:4

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 39204

RELEASED
07.09.04

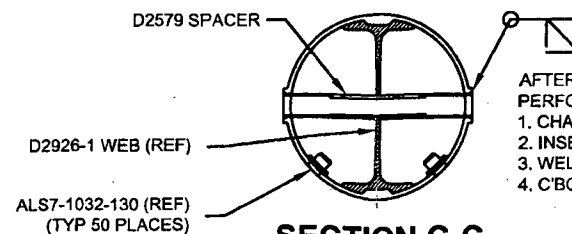

SECTION C-C
SCALE 1:4

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (22 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP


DESIGN	90	DART AEROSPACE LTD	
DRAWN	C.B.	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PH	DRAWING NO.	REV. B
MFG. APPR.	21	D2906	SHEET 2 OF 3
APPROVED	21	TITLE	SCALE
DE APPR.	21	AH-1 (209) SKIDTUBE ASSEMBLY	1:24
DATE	07.08.21	COPYRIGHT © 2004 BY DART AEROSPACE LTD	
		THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

8 7 6 5 4 3 2 1



SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 39204

RELEASED
07-09-04

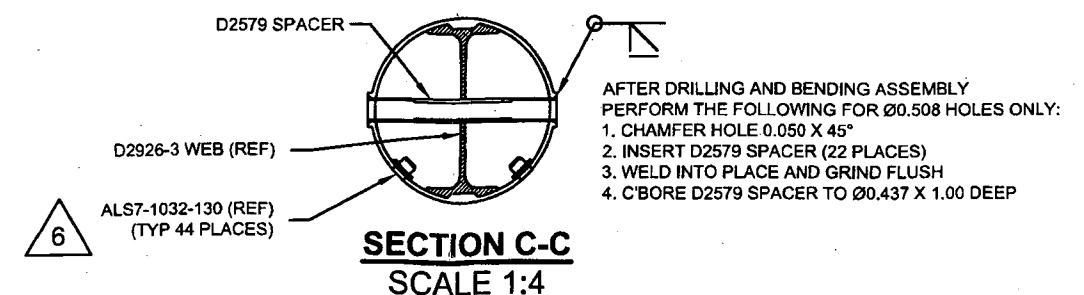

DESIGN	QD	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	CB		
CHECKED	PH	DRAWING NO.	REV. B
MFG. APPR.	SH	D2906	SHEET 3 OF 3
APPROVED	QD	TITLE	SCALE
DE APPR.	SH	AH-1 (209) SKIDTUBE ASSEMBLY 1:24	
DATE 07.08.21		COPYRIGHT © 2004 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

NO. 154

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Barclay Elliot
Job number: 38940A
Part number: D205 634041
Description: Skid tube 205
Welding Process: Tig ☒ Mig ☐
Base material: Aluminium
Current: AC ☒ DC ☐

TEST REQUIREMENTS AND RESULTS

Visual:
Penetration:

pass ☒ fail ☐
pass ☒ fail ☐

UNACCEPTABLE

Cracks:
Undercut:
Pin holes:
Overlap (cold lap)
Porosity (surface):
Coloration:

pass ☒ fail ☐
pass ☒ fail ☐
pass ☒ fail ☐
pass ☒ fail ☐
pass ☒ fail ☐
pass ☒ fail ☐

Qualifier Del Duval Date of Test Coupon 0805-07

Welder Barclay Elliot Date of Test Coupon 08-05-07

The above named individual is qualified in accordance with AWS D17.1.2001 to weld